

tempmate®-S2

OPERATION INSTRUCTIONS


 Start Button

 Green LED


 Red LED




01 Keep button pressed for minimum 5 seconds to start recording

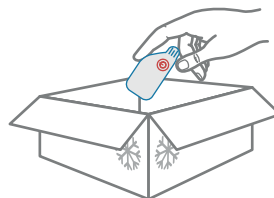

02 Add started **tempmate®-S2** to your shipment

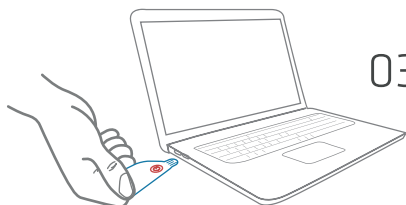

03 Connect stopped logger directly to USB port

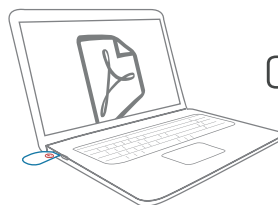

04 The PDF report will be generated automatically



5 sec.

Start Logger
Stop Logger

Rec.



Stop




1 time

Not started
Low battery




3 sec.

Recording-OK



Recording-Alarm



Stopped-OK



Stopped-Alarm



2 times

Set Mark
Mark limit full

Mark



Mark

