

15 Watt Solar Panel Installation Instructions (SOLAR-15W)

Items Included

- 15 watt solar panel with adjustable bracket mounting hardware (tilt arm, bracket, clamps, bolts, lock washers, washers, and nuts; additional optional hardware may be included that is not required for this installation)
- Two U-bolts with saddle and two flanged nuts for mounting solar panel to a 4.1 cm (1.63 in.) diameter mast

Tools Required

Note: Both Metric and English sizes are required.

- One 10 mm wrench
- Two ½ inch wrenches


Important: The solar panel **must** be mounted where it will receive full sunlight or performance will be severely degraded.

Specifications

Power	15 Watts
Operating Temperature Range	-40° to 85°C (-40°F to 185°F)
Materials	Polycrystalline silicon solar cell; aluminum frame and mounts; zinc-coated steel bolts, nuts, washers, and U-bolts
Dimensions	428 x 357 x 30 mm (16.85 x 14.06 x 1.18 in)
Weight	2.2 kg (4.85 lb)
Cable Length	2 m (6 ft)
Environmental Rating	Weatherproof when mounted properly, not waterproof
CE	The CE Marking identifies this product as complying with all relevant directives in the European Union (EU).


1 Remove any plastic on the solar panel or hardware. It is recommended that you lubricate all nuts and bolts with multi-purpose or protective lithium grease to facilitate easy removal at a later date. Two people may be needed to perform some of these installation steps.

2 a. With the cable side of the solar panel facing up, center the tilt arm on the solar panel, oriented as shown with the shorter end of the tilt arm flush against the edge of the solar panel frame.

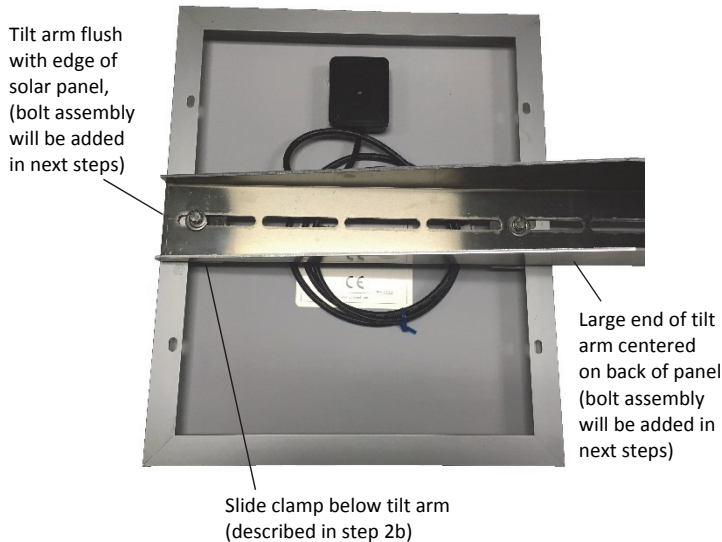


b. Working on the flush edge first, slide a clamp under the edge of the frame, lining up the hole in the center of the clamp with the slot in the tilt arm.

c. Place a lock washer, small washer, medium washer, and large washer on the bolt (the lock washer is closest to the bolt head). Insert the bolt/washer assembly through the slot in the tilt arm and into the hole in the clamp as shown. Use a 10 mm wrench to loosely tighten the bolt.

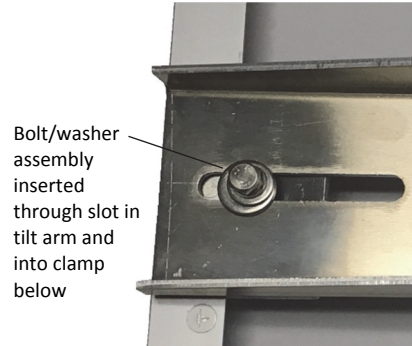

Bolt/washer assembly inserted through slot in tilt arm and into clamp below

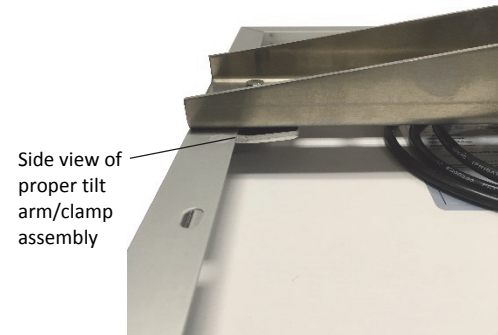


Side view of proper tilt arm/clamp assembly


d. Repeat steps 2b through 2c with the opposite side of the tilt arm.

e. Tighten both bolts with the 10 mm wrench. Do not overtighten the bolts.


-
- 3** Insert the bracket into the larger end of tilt arm as shown. The solar panel may not stand on its own; be sure to support it.

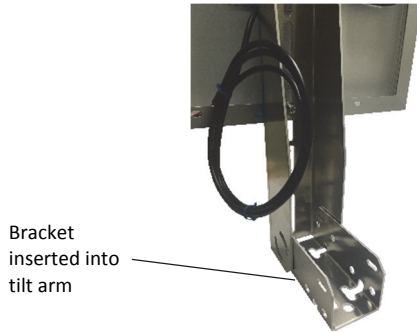

-
- 4** Insert the larger bolt and medium washer into the arc hole on the tilt arm, making sure it protrudes through the hole in the bracket. Place a medium washer and large lock washer on the end of the bolt inside the bracket and finger tighten. Repeat with three other bolts, one on the same side and two on the opposite side.

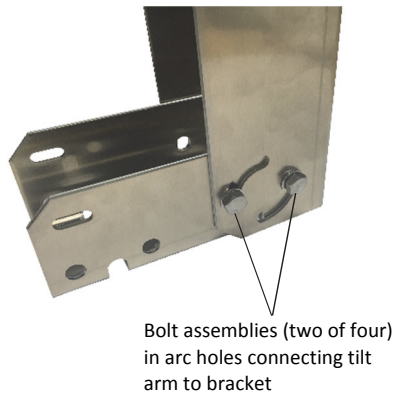

-
- 5** Insert the U-bolts through the bracket to attach them to the mast as shown. Attach the U-bolt saddles and move the bracket to the desired position on the mast. Use a ½ inch wrench to tighten the flanged nuts on the U-bolt assemblies.

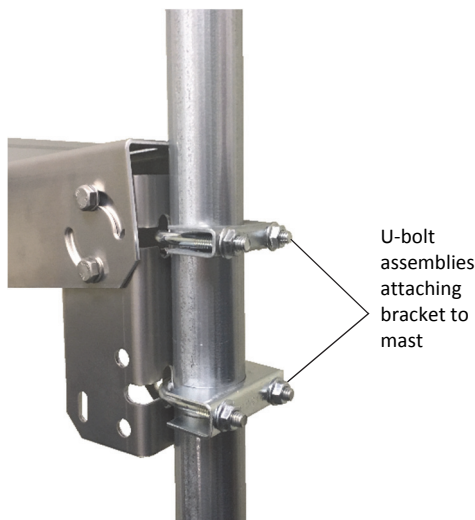

-
- 6** To adjust the angle of the solar panel, loosen the bolts on the tilt arm and reposition them in the arc holes. Adjust the angle to maximize the amount of light directed at the solar panel during periods of the shortest duration of daylight. Once the solar panel is at the desired angle, use two ½ inch wrenches to tighten the bolts (one to hold the bolt head steady, the other to tighten the lock washer inside the bracket).



-
- 7** Plug the cable into the HOBO station's charging port. Refer to the HOBO station user's manual at www.onsetcomp.com/support/manuals for the location of the charging port on the station. Use zip ties to secure the cable against the mast.